

## Fig. 599 Socket Clamp Washer Fig. 600SC Socket Clamp for Ductile Iron or Cast Iron Pipe

## Fig. 600SC

Socket Clamp for Ductile Iron or Cast Iron Pipe

Size Range: 3" through 24" pipe

Material: Two carbon steel halfbands and two bolts and nuts.Finish:Plain orHot-Dip Galvanized with EG Bolts & NutsService:Clamps joints of socket fittings together to preventdistortion of pipe line under excessive water pressure.Approvals:Complies with Federal Specification A-A-1192A (Type 8),ANSI/MSS SP-69 and MSS SP-58 (Type 8).

Features: An economical method of anchoring joints of socket fittings when used on other than fire protection work.

Ordering: Specify pipe size, figure number, name and finish.



## Fig. 599

## Socket Clamp Washer

Two cast iron or steel washers, Fig. 599, are used with each Fig. 600 socket clamp and these must be ordered separately. **Ordering:** Specify washer size, figure number, name and finish.

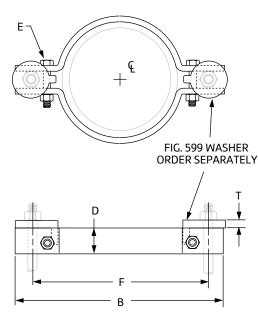


Fig. 600, Fig. 599: Dimensions (in) • Weight (lbs)									
D.I./C.I. Pipe Size	Weight								Fig. 599:
	Fig. 600: Clamp	Fig. 599: Washer	D.I.P. O.D.	В	D Width	Bolt Dia. E	F	т	Washer Rod Dia.
3	9.7	- 1.2 -	3.96	115/8	- 2	5/8	85/8	- <sup>5</sup> /8	3/4
4	11.0		4.80	121/8			9 <sup>3</sup> / <sub>4</sub>		
6	12.7		6.90	14 <sup>3</sup> /8			12		
8	14.5		9.05	165/8			141/4		
10	16.3		11.10	187/8			161/2		
12	18.3		13.80	21¼			187/8		
14	48.7	2.7	15.80	<b>25</b> <sup>1</sup> / <sub>2</sub>	3	7/8	23	11//8	11/4
16	69.2		17.40	28	- 4 -	1	25 <sup>1</sup> / <sub>2</sub>		
18	82.0	4.5	19.50	<b>31</b> ½		11⁄4	275/8		
20	97.5		21.60	333/4	4 <sup>1</sup> / <sub>2</sub>		29 <sup>3</sup> /4		1 <sup>3</sup> /8
24	132.0	6.8	25.80	39 <sup>3</sup> /4	5	11/2	351/4	11/4	1 <sup>1</sup> /2

PROJECT INFORMATION	APPROVAL STAMP			
Project:	Approved			
Address:	Approved as noted			
Contractor:	Not approved			
Engineer:	Remarks:			
Submittal Date:				
Notes 1:				
Notes 2:				